


The Ontario Occupational Health and Safety Act (O. Reg. 278/05) mandates an asbestos management program to owners of buildings.

**Elyxyr's ACM Control** is a **cloud-based software service** that **facilitates** and **simplifies** organizations' **compliance** to this mandate.

## FEATURES

- **Cloud-based Software-as-a-Service (SaaS)** minimizes total cost of ownership.
- SaaS hosted in Canada. 🇨🇦
- Organization-wide **alerts** to track asbestos condition and required action. ①
- **Web-access** to up-to-date records for all stakeholders such as owners, occupiers and maintenance workers.
- Streamlines **access to information**:
  - ⇒ Various search filters: by room, materials, samples, floor, room name, etc. ②
  - ⇒ Ability to sort information by samples, updates, location, condition, materials, priorities and etc. ③
- **Central Document Repository** by building for surveys, lab results, images, consultant reports, etc. ④
- Asbestos records contain **all data elements** required by the regulation. ⑤
- Comprehensive organization-wide **audit reports** captures before and after record information. ⑥
- Tracks and provides **history of clean-ups, assessments, repairs and abatements**.
- Generates **printer-friendly reports** required for onsite asbestos records. ⑦
- **Simplifies record keeping** of annual inspections, ongoing repairs and abatements to ACM.
- Record **laboratory results** and upload laboratory results **documentation and pictures**.
- Interacts seamlessly with **Asbestos Reports PDFs**. ⑧

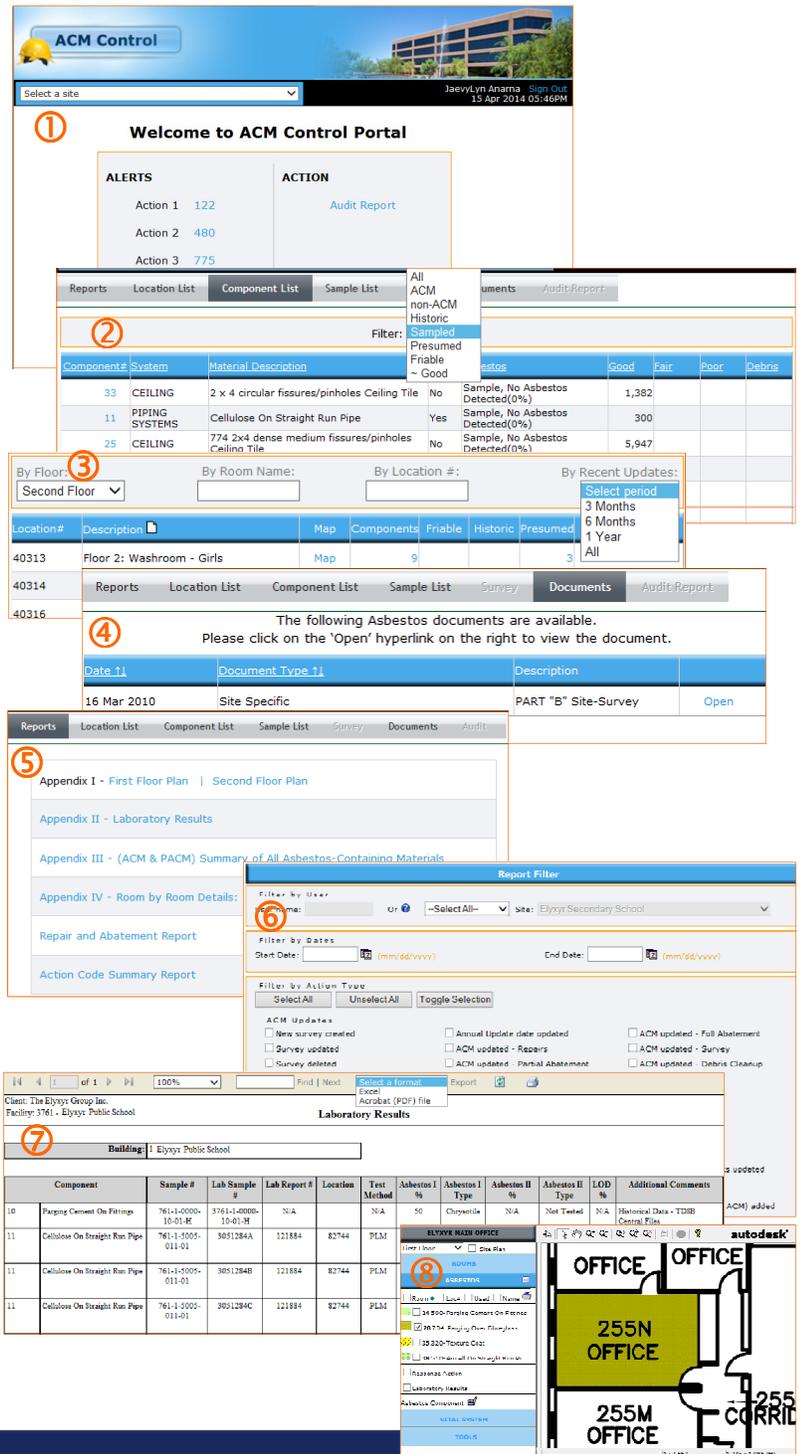

**1. Welcome to ACM Control Portal**

**2. Alerts and Action Summary**

Alerts	Action
Action 1: 122	Audit Report
Action 2: 480	
Action 3: 775	

**3. Search and Filter Options**

By Floor: Second Floor | By Room Name: | By Location #: | By Recent Updates: 3 Months, 6 Months, 1 Year, All

Component#	System	Material Description	Frangible	Historic	Presumed	Asbestos	Good	Fair	Poor	Debris
33	CEILING	2 x 4 circular fissures/pinholes Ceiling Tile	No	Sample, No Asbestos Detected(0%)			1,382			
11	PIPING SYSTEMS	Cellulose On Straight Run Pipe	Yes	Sample, No Asbestos Detected(0%)			300			
25	CEILING	774 2x4 dense medium fissures/pinholes Ceiling Tile	No	Sample, No Asbestos Detected(0%)			5,947			

**4. Document Repository**

The following Asbestos documents are available. Please click on the 'Open' hyperlink on the right to view the document.

Date	Document Type	Description	Action
16 Mar 2010	Site Specific	PART "B" Site-Survey	Open

**5. Report Filter**

Filter by User: [User] | Filter by Dates: Start Date: [mm/dd/yyyy] End Date: [mm/dd/yyyy]

**6. Report Filter (ACM Updates)**

ACM Updates:  New survey created,  Survey updated,  Survey deleted,  Annual Update date updated,  ACM updated - Repairs,  ACM updated - Partial Abatement,  ACM updated - Full Abatement,  ACM updated - Survey,  ACM updated - Debris Cleanup

**7. Laboratory Results**

Component	Sample #	Lab Sample #	Lab Report #	Location	Test Method	Asbestos I %	Asbestos I Type	Asbestos II %	Asbestos II Type	LOD %	Additional Comments
10	Paving Cement On Fittings	761-1-0000-10-01-H	3761-1-0000-10-01-H	N/A	N/A	50	Chrysotile	N/A	Not Tested	N/A	Historical Data - TDDB Central Files
11	Cellulose On Straight Run Pipe	761-1-0005-011-01	3051284A	121884	82744	PLM					ACM added
11	Cellulose On Straight Run Pipe	761-1-0005-011-01	3051284B	121884	82744	PLM					
11	Cellulose On Straight Run Pipe	761-1-0005-011-01	3051284C	121884	82744	PLM					

**8. Map View**

Map showing office locations: 255N OFFICE, 255M OFFICE, 255 CORRIDOR.